




US20-10-7-SS

Ruland US20-10-7-SS, 5/8" x 7/16" Single Universal Joint, Friction Bearing, Stainless Steel, 1.245" OD, 3.750" Length

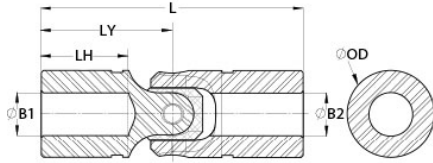

Description

Ruland US20-10-7-SS is a single cardan friction bearing universal joint with 0.6250" x 0.4375" bores, 1.245" OD, and 3.750" length. It is ideal for applications with space constraints and has higher torque capacity than equivalently sized double universal joints. This plain bearing universal joint is comprised of pins and blocks that are precision machined, selectively heat treated, and ground for high strength, accuracy, and wear resistance. The combination of these components with precision ground and hardened yoke ears allow for a longer lifespan, increased performance in demanding applications, and greater angular misalignment of up to 45° when compared to commodity style single universal joints. US20-10-7-SS is made from high grade stainless steel for increased corrosion resistance. It can be combined with boot UBOOT20/32-NI-KIT to protect the joint from unwanted contaminants such as dust or water and self lubricate reducing maintenance time. This single cardan universal joint is manufactured in the USA by Belden Universal for strict control of processes.

Product Specifications

Bore (B1)	0.6250 in	Small Bore (B2)	0.4375 in
B1 Max Shaft Penetration	1.250 in	B2 Max Shaft Penetration	1.250 in
Joint Outer Diameter (OD)	1.245 in	Bore Tolerance	+0.0010 in / -0.0000 in
Length (L)	3.750 in	Yoke Length (LY)	1.875 in
Hub Depth (LH)	1.250 in	Peak Torque	3400 in-lb
Rated Torque	680 in-lb	Max Operating Angle	45°
Material Specification	Stainless Steel	Manufacturer	Belden Universal
Country of Origin	USA	Weight (lbs)	0.903000
Recommended Lubricant	LUBRIPLATE No. 1200-2	Matching Boot Cover	UBOOT20/32-NI-KIT
UPC	63452937045	Tariff Code	8483.60.4000
UNSPC	25173810		
Note 1	Performance ratings are for guidance only. The user must determine suitability for a particular application.		
Prop 65	⚠ WARNING This product can expose you to the chemical Nickel (metallic), known to the State of California to cause cancer. For more information go to www.P65Warnings.ca.gov .		